







The emergency response and the coordination between IEP and EEP: evaluation and control during the Seveso Inspections

STRATEGIES FOR EMERGENCY PLANNING AND LAND USE PLANNING FOR SEVESO SITES

Case studies and exchanges of bilateral experience Italy/Europe Siracusa (Italy), 1-2-3 October 2025

Romualdo Marrazzo (HSE Senior Expert, Seveso and IPPC-IED Inspector)

Head of the Integrated Analysis of Industrial Risks Section (VAL-RTEC-IND)

ISPRA – Italian National Institute for Environmental Protection and Research

The role of ISPRA for industrial control

ISPRA has a national role as a technical body supporting the Ministry of Environment in the national implementing of the Seveso Directives for the prevention of major accidents (D.Lgs. 105/2015)

Definition of <u>technical</u>
<u>contents of laws and</u>
<u>decrees</u> to control Major
Accidents

Set-up of the National
Inventory of major
accident hazards
establishments and
other related data-bases

Evaluation activity for the Notification form and "exclusion of substances" procedure

Pluri-annual Planning
and Inspections of UT
establishments SMSPMA on a regular basis
or after an accident

Support for <u>international</u> <u>activities</u> (EU, OECD, bilateral cooperation)

Technical coordination and <u>addressing of</u>

Regional Agencies for the Protection of Environment (ARPA)

Collaboration with other

Authorities competent
for industrial risk
(National Fire Brigades;
Civil protection; Ministry
of infrastructures)

Training for Seveso national inspectors aimed at Italian CCAA





Program and themes

- 1. The procedure for the SMS-PMA Inspections
- 2. The checklist for the verification: focus on the emergency planning element
- 3. Feedback and findings from "on-site" activities in a refinery
- 4. Final results: need for improvement and corrective actions












1. The procedure for the SMS-PMA Inspections

The site operator tasks

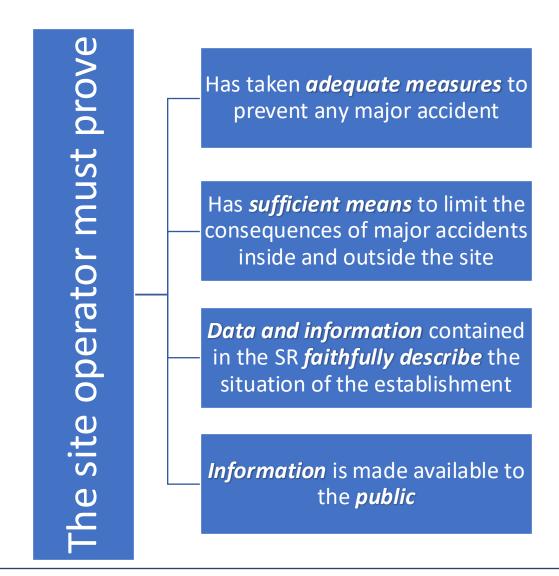



The Inspection Commission

A commission is charged by the Italian Authority for UT Establishments (Regional Fire Brigade):

- ISPRA (Institute for Environmental Protection and Research)/ARPA (SNPA)
- CNVVF (Local Fire Brigades)
- INAIL (Safety at Work Institute)

The commission must verify the suitability of the operator MAPP and the implementation of the SMS, carrying out a planned examination of the systems being employed at the establishment, whether of a technical, organizational, or managerial nature





The national regulation

- 2 fundamental legislative instruments relevant to the SMS inspections
- 1) <u>D. Lgs. 105/2015 Allegato B "Linee guida per l'attuazione del Sistema di Gestione della Sicurezza per la prevenzione degli incidenti rilevanti"</u>
 - MAPP and SMS structure: technical contents, deepness, training activities
 - State of the art: UNI 10617 (UNI10616), ISO 45000-ISO14000-EMAS (MAP)
- 2) <u>D. Lgs. 105/2015 Allegato H "Criteri per la pianificazione, la programmazione e lo svolgimento delle ispezioni"</u>
 - Criteria and procedures for conducting inspections: procedures and formats (check-list, operational experience, critical systems) for SMS-MAPP inspections
 - Simplification of some items: for establishments with high standardization (depots, storage sites, transferring, etc.)











2. The checklist for the verification: focus on the emergency planning element

6.i Consequence analysis, planning and documentation

- ☐ Internal Emergency Plan (IEP) contains information about
 - Accidental <u>scenarios</u>; <u>MSDS</u>; Emergency <u>systems</u>; Plans of the establishment with <u>meeting points and escape ways</u>; Emergency <u>actions</u>; <u>Communication</u> lines; Procedures for <u>alert</u>, <u>alarm</u>, <u>and evacuation</u>; <u>Damages</u> to operators, environment, population, plants and equipment
- Accident scenarios in IEP are congruent with the safety analysis
- Consistency of the IEP with the EEP (External Emergency Plan)
 - <u>Scenarios and technical elements</u> for emergency management; Modes of <u>communication</u> in relationship with the <u>different hazard levels</u>
- ☐ The IEP has been reviewed/updated at intervals not exceeding three years, after consultation of the representatives of internal employees, including the "long term" third-party workers



6.ii Roles and responsibilities

- Responsibility of emergency management has been assigned
- □ Roles, tasks, and responsibilities have been assigned for any action
- □ Substitutes are identified in case of absence of the person in charge of the emergency management
- Adequacy of the emergency response team which can be mobilized in case of emergency, assuring its timely intervention



6.iii Checks and monitoring to manage the emergency situations

- Controls and inspections of the emergency systems, plants, and equipment for fire fighting and the mitigation of the consequences
- Protective equipment is made available to the personnel and is periodically checked in terms of availability and functionality
- Personnel has been trained concerning:
 - Specific <u>scenarios of emergency</u> management; Use of <u>the personal protective</u> <u>equipment (PPE)</u>; Placing of <u>collective protection systems</u>
- Planning of the emergency drills for the accident scenarios considered in the safety analysis
- Outcomes of emergency drills are documented
 - Response times and implementation of any action of improvement
- Minimal composition of the emergency team is defined



6.iv Alarm systems, communication, and support to external response

- ☐ Information for the people and workers about the risks of a major accident of the establishment is sent to city mayors
- Modes of cooperation with external authorities are established
- Documents are prepared for the External Emergency Plans and to support the actions to protect the environment and the population
- □ The plan of emergency management includes the responsibility of cooperating with the external operators after a major accident
- □ A procedure is put in place for post-accident analysis, including the reporting and the safeguarding of the objective evidence
- ☐ Efficiency of the lines of communication inside and outside the site



6.v Assessment on systems related to the management of emergency

- Conditions of accessibility, escape ways and meeting points, location of equipment, wind-cones in case of release of toxic substances
- Availability of the technical support documentation to be used in case of emergency
 - MSDS; IEP; Emergency <u>Instructions</u>; Procedures for the <u>safety of</u> <u>plants</u>
- ☐ Systems to count the number of persons present in the establishment

6.vi Control room and/or emergency management center

- ☐ Efficiency of the indicators of critical process parameters, alarms, warning systems and anything else required for emergency
- Availability of technical documentation during the emergency in the control room
 - Operating <u>manuals</u>, <u>MSDS</u>, <u>IEP</u>, <u>P&ID</u>, drawings and <u>schemes</u> of the plants









3. Feedback and findings from "on-site" activities in a refinery

The inspection mandate: specific checks on the «Emergency Management»

...The Commission shall conduct a planned and systematic examination of the technical, organizational, and management systems applied in the establishment, to verify the adoption by the operator of the measures and means for the prevention of major accidents and for the limitation of their consequences...

✓ To assess the compliance of the SMS-PMA with point 6 of the inspection checklist, regarding the methods of communication, collaboration, and support with external authorities, the commission shall carry out a specific emergency drill preferably involving the local Fire Brigade Command

The drill on the accident scenario

The members of the Commission attended, as observers, an emergency drill of the type "RELEASE OF FLAMMABLE GAS FROM THE COMPRESSOR DELIVERY (TOPPING plant)"

 The drill subsequently included the <u>triggering of the toxic</u> <u>release</u> with the generation of <u>Jet fire</u>, with the (<u>hypothesized</u>) <u>presence of an injured</u> person assigned to the emergency management <u>team</u>



Development of the emergency drill: activity on the plant

- ✓ HC detector alarm near the topping (third-party operators with sample cylinder): the optical-acoustic alarm signal was activated on-site
- ✓ Alarm button from the company fire station with activation of the IEP
- ✓ Once the release was confirmed, start of the emergency via siren and site intercom
- ✓ Implementation of site operating instructions for process management and fire-fighting activities
- ✓ First-aid team intervention to rescue the company firefighter who fell while getting out of the vehicle
- ✓ Emergency team of the topping to verify the actual dispersion of flammable material and Electrical safety team
- ✓ First response team of company firefighters from the fire station



Development of the emergency drill: intervention of the FFT

- ✓ Sprinkler system at the plant section to dilute the toxic cloud and mitigate the thermal and radiation effects of the subsequent jet fire
- ✓ Collaboration of the refinery with the team of the local fire brigade, which intervened following the call made by the Internal Coordination Group established at the control room (External Coordination Group)
- ✓ Laying of flexible fire hoses by the first response team and activation of those of the Fire brigade, to put out the initial phase of the Jet-Fire
- ✓ Verification and remediation of the area following the event, by measuring "on-site" for the presence of H2S
- ✓ Return of the plant to the operator by the Fire brigade to restore operating conditions
- ✓ Closure of the emergency was signaled by the siren, by the operator



The personnel involved: the final debriefing meeting

- Composition of the first response team
 - Production Manager
 - Topping shift leader
 - Topping operators
 - Fire-fighting shift leader and substitute
 - Fire-fighting operators
 - Power-plant operators
- Electrician on duty
- Head of fire department
- Console operators in the control room
- ☐ Internal and External Coordination Groups
- Other personnel present on-site

Team of the Local Fire Brigade

- Driver (responsible for the vehicle)
- Team leader
- Firefighter coordinator
- Firefighters to manage the intervention



The judgment of the inspection commission on the drill

- The operational figures have demonstrated that they know the sequence of operations to be implemented in the emergency phase
- The procedures have been implemented appropriately for the plant's operational phase and fire intervention
- The emergency management systems in the area affected by the event have been activated in the correct sequence
- The event has been adequately managed from the control room, including the internal coordination and communication phases, collaboration and support to external authorities











4. Final results: need for improvement and corrective actions

Operational aspects of the site emergency management

- Make it clear that the Department Emergency Plans represent operational tools for implementing the general procedure indicated in the IEP
- Specify the figures who carry out the main operations, on the systems (auxiliary firefighters) and of an emergency nature (firefighters), correctly allocating the responsibilities of the first response team
- Complete the operational sheets with all the "on-site" verification activities, for the post-emergency (exposure meters, sirens, etc.)



Communication and support for external intervention

- Identify the minimum set of information to be provided to External Authorities (telephone call to the Local Fire Brigade Command), concerning the specific emergency in progress and the site's conditions, to best direct the intervention and rescue activities
- Check the audibility level of the alarms via the plant intercom, considering the background noise and wind direction, to guarantee uniform sound distribution within all areas of the plants
- Participation, in the debriefing meetings, of an observer of the work of third-party companies within the plants, to represent the actual involvement and any related needs and observations



Final considerations

- Within the planned and systematic verification activities, the evaluation of the prevention and mitigation measures emerging from the risk analysis and established in the IEP plays a key role
- To assess compliance with the "emergency management" element of the SMS-PMA, as a completion of documentary analysis, it is necessary to carry out specific emergency drills
 - Sequence of <u>operations</u> to be implemented by the <u>response teams</u>
 - Appropriate implementation of <u>operating procedures</u>
 - Activation of <u>emergency management systems</u>
- The involvement of the local Fire Brigade allows us to focus on methods of collaboration and support with authorities in case of EEP
 - Management from the <u>control room</u>, including the internal <u>coordination and</u> <u>communication</u> phases, as well as the <u>activities</u> carried out "<u>on-site</u>"












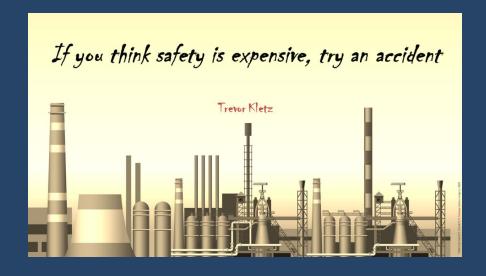

Questions...???...

romualdo.marrazzo@isprambiente.it

Thanks for the attention!!!

